
29

TRACKSTER SERVICE BULLETIN

Service Dept. CUSHMAN MOTORS Lincoln, Nebraska

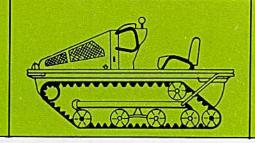

FUEL SYSTEM CLOGGING

Recent reports have indicated fuel filters and fuel pick up screens have been plugging with a jel-like substance.

We have found that the jel-like substance is caused by a bacteria growth and has its origin primarily in gasoline storage tanks. At times, this bacteria will enter the vehicle gas tank and grow in the presence of any amount of water, such as condensation forming in the tank.

To remove gel which is present in the tank, we recommend the tank be removed and washed out with hot water/steam, air-dried and rinsed with alcohol. Clean the screen in the same manner or replace with a new screen. Replace the fuel filter.

To prevent the system from plugging again, use a gasoline additive such as "Heet" at the proportion recommended by the manufacture. Do not exceed their recommendations.

A RESTRICTED FUEL SYSTEM WILL CAUSE A LEAN FUEL CONDITION AND MAY RESULT IN ENGINE DAMAGE.

1M-2-75-GP TB-29